TECHNICAL BULLETIN LTB00768v2 30 NOV 2015



© Jaguar Land Rover Limited All rights reserved.

This bulletin supersedes TSB LTB00768/2015 dated 14 APR 2015, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.

Changes are highlighted in gray

SECTION: 303-00

3.0L TDV6 Valve Cover Split And/Or Cracked

AFFECTED VEHICLE RANGE:

Discovery 4 / LR4 (LA)

Model

2010-2015 Year:

508020-765561 VTN:

Assembly

Solihull Plant:

Range Rover Sport (LS)

Model Year:

2010-2013

VIN: 209306-814822

Assembly

Plant:

Solihull

Range Rover (LG)

Model Year:

2013-2015

VIN:

000012-224410

Assembly

Plant:

Solihull

Range Rover Sport (LW)

Model Year:

2014-2015

VIN:

000001-525081

Assembly

Plant:

Solihull

Range Rover Sport (LW)

Model Year:

2014-2015

VIN:

600000-621222

Assembly

Plant:

Solihull

Engine:

Engine:

Engine:

Engine:

TDV6 3.0L Diesel

TDV6 3.0L Diesel

TDV6 3.0L Diesel

Engine:

TDV6 3.0L Diesel

TDV6 3.0L Diesel

MARKETS:

Diesel Markets Only

CONDITION SUMMARY:

Situation: A customer may report a concern that the vehicle has restricted performance.

This version has been issued for a change to the VIN details.

Cause: Material thickness and fillet radius of the valve cover not to specification. Suggested Customer concern

code MX2.

Action: Should a customer express concern, follow the Service Instruction outlined below.

PARTS:

LR073585 Left valve cover Quantity: 1
LR074623 Right valve cover Quantity: 1

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.


NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Discovery 4/LR4 (LA) - Right	12.29.44	7.7	42	LR057379
Discovery 4/LR4 (LA) - Left	12.29.43	8.2	42	LR057379
Discovery 4/LR4 (LA) - Full Set	12.29.42	13.1	42	LR057379
Range Rover Sport (LS) - Right	12.29.44	8	42	LR057379
Range Rover Sport (LS) - Left	12.29.43	7.2	42	LR057379
Range Rover Sport (LS) - Full Set	12.29.42	12.4	42	LR057379
Range Rover (LG) - Right	12.29.44	5.5	42	LR057379
Range Rover (LG) - Left	12.29.43	7.2	42	LR057379
Range Rover (LG) - Full Set	12.29.42	9.8	42	LR057379
Range Rover Sport (LW) - Right	12.29.44	5.7	42	LR057379
Range Rover Sport (LW) - Left	12.29.43	7.3	42	LR057379
Range Rover Sport (LW) - Full Set	12.29.42	10.2	42	LR057379

> NOTE: Normal Warranty procedures apply.

COMPONENT LOCATION

1. The illustration shows the component location.

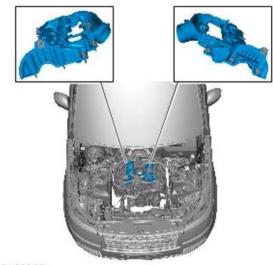

E186357

SERVICE INSTRUCTION:

- Install a new engine valve cover left (see TOPIx Workshop Manual, Section 303-01 Engine TDV6 3.0L Diesel - Valve Cover LH).
- 2. Install a new engine valve cover right (see TOPIx Workshop Manual, Section 303-01 Engine TDV6 3.0L Diesel Valve Cover RH).