TECHNICAL BULLETIN

No: LTB00313 (ISSUE 1) 06 JAN 2011



CIRCULATE TO:

SERVICE PARTS WARRANTY BODY SHOP

SECTION: 501

Ashtray Will Not Close / Ashtray Carrier Availability

AFFECTED VEHICLE RANGE:

LR3 (LA) VIN: 5A000360 - 9A513325

Model Year: 2005 - 2009

CONDITION SUMMARY:

Situation: The ashtray may not close fully. This may be caused by the ashtray carrier and not the ashtray. It is no longer necessary to replace the complete ashtray.

Action: In the event of a customer concern of the above, refer to the Repair Procedure outlined below to replace the ashtray carrier only and not the complete ashtray.

PARTS:

LR022570Ashtray carrier Qty: 1

TOOLS:

Refer to Workshop Manual for any required special tools

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	Time (HOURS)	CONDITION CODE	CAUSAL PART
Carrier - Ashtray - Renew	76.67.29	0.10	42	FKB500050WBQ

Normal Warranty policies and procedures apply

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.


REPAIR PROCEDURE

REPLACE THE ASHTRAY CARRIER


NOTE: Co

NOTE: Complete ashtray shown removed for clarity.


1. Remove the ashtray from the ashtray carrier. (Figure 1)

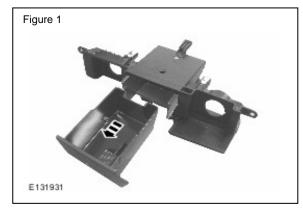

2. Using suitable tools, gently press against the ashtray carrier fixing clips and remove the ashtray carrier. (Figure 2)

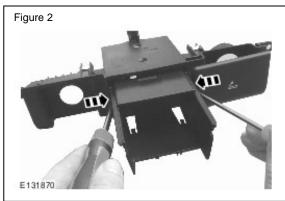

3. Install the new ashtray carrier (LR5022570). (Figure 3)

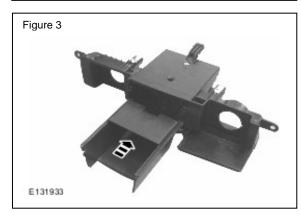

- 4. Install the original ashtray. (Figure 4)
- 5. Verify ashtray operation.

