

1117353

Code P21880 23377 610 R17353

SMW PLAN 8

Warranty Wise Repairer's Assessment

Date 16/03/2011 Plan Number 543544

VEHICLE DETAILS

Planholder	TOMLIN	Name & Address of Repairer	FAO CAROLINE DOWNIE SHIF. DIS LANDROVER 1000 KENN SHEAD ROAD GLASGOW G53 7ZA
Make	LANDROVER	Tel	0141 876 1001
Model	DISCOVERY	Fax	0141 876 1186
Reg No	A15144	Vat Reg No	624176645

DETAILS OF REPAIR REQUEST

Current Mileage	8705	Fuel Type	DIESEL
Vin / Chassis No		Country of Origin	
Date of Breakdown	16/03/2011	Name of Faulty Part Part Numbers and Individual Prices RPT FUEL INJECTION INJECTOR PIPES, O RING TURBO INJECTION	
Description of Repair	MISCURE CHECK FAULT CODES, CHECKED DATA, NO 4, NO 6 SHOWING FAULTY, STRIP DOWN AND CHECK WIRING TO ALL INJECTORS, CARRY OUT LEAK OFF TEST DISCONNECT FEET & INJECTORS, NO 4 AND NO 6 MISFIRE WORSE, REMOVE AND INSPECT AND CARRY OILY COMPRESSION TEST, O INJECTORS		
Reason for Part Failure	Please State Reason for Part Failure & Provide any Diagnostic Printouts PLEASE PROVIDE THE FULL DIAGNOSTICS PRINT OUT FOR ALL REPORTED FAULTS <i>SEE ATTACHED SHEETS : IF FURTHER INFO. REQUIRE PLEASE SPEAK TO OUR V/SHOP CONTROL: STUART HAYIE 0141 8761001</i>		
Estimated Cost of Repair (ex. Vat) Inc Recovery & Car Hire	Parts £ 1259.00	Labour £ 935.00	Hours 17.0
	Recovery £ 00.00	Car Hire £ 00.00	Totals £ 2824.00
NB: Estimated costs may differ from the final Authorised Amount Repairer Sign: Name: Date:			

RECEIVED 16 MAR 2011

After completing this assessment form (fully) please fax/post to: Warranty Wise (Repairs Department), Ribble Court, 1 Mead Way, Padibans, Lancashire. Tel: 0845 293 2570. Fax: 01282 277 2125

Please take your instructions from the vehicle owner regarding authorisation for the stripdown and to confirm the payment of your invoice. Do not complete any repairs until Warrantywise have decided whether (or not) an Independent inspection is required and issued authorisation.

Fraud is a serious crime and anyone attempting to make a fraudulent request will be prosecuted.

This request for repair is made by the vehicle owner, subject to Warrantywise plan limits, exclusions and terms and conditions. The completion of this form does not guarantee authorisation or any payment from Warrantywise. However, failure to complete and sign this form will result in any decision being delayed.

WIPAC (Accessories) (Intel) (Java) (Active) (New) (Default) (Default) (Default)




WIPAC (Accessories) (Intel) (Java) (Active) (New) (Default) (Default) (Default)



Vehicle Settings Sessions

Session Recommendations


Cylinder balancing offset - 1.75K

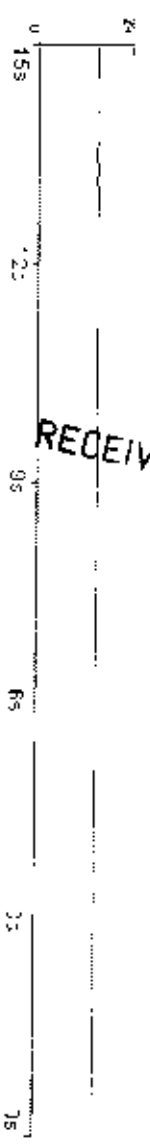

Cylinder balancing offset - 1.44K



Cylinder balancing offset - 1.05K

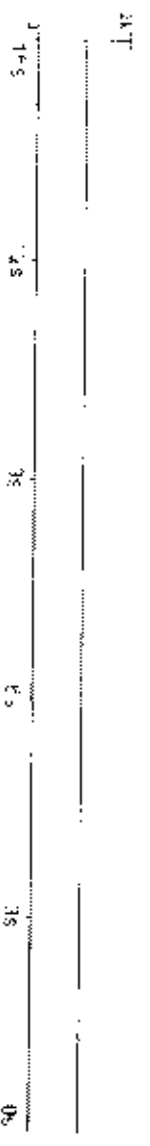

Cylinder balancing offset - 1.01K



RECEIVED 16 MAR 2010



Done

Diagnosis Application - 015

File Edit View Favorites Tools Help

http://pc.nissantechnology.com/pc/techsupport/pcdiag.html



DISCONNECT THE BATTERY FROM THE ENGINE AND WAIT 15 MINUTES (15 MIN)

Vehicle Settings Sessions


Session Selected Symptoms Related Events Unrelated Events Recommendations Extras

RECEIVED 16 MAR 2010


Cylinder balancing offset




Cylinder balancing offset

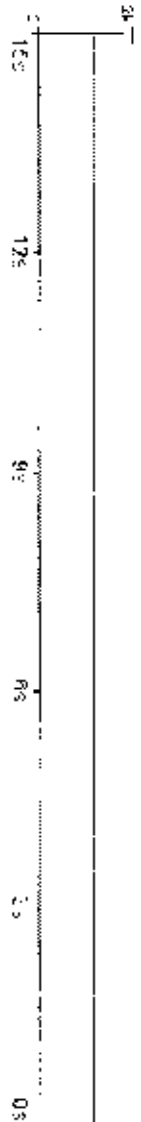

Cylinder balancing offset

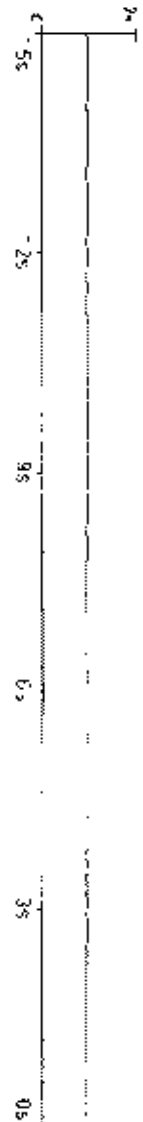

Cylinder balancing offset

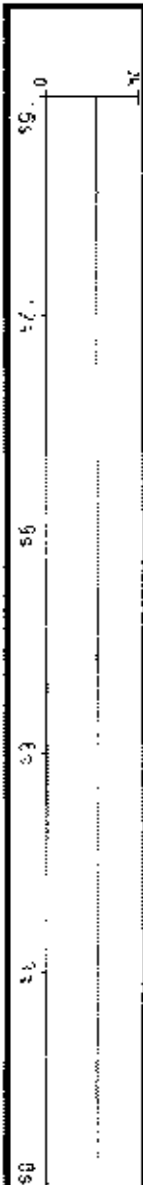

Diagnosis

Start

System

Diagnosis Application

Diagnosis Application

15:46

